

SONY KV27v42 RGB upgrade.
04/Sep/2020

Removed R086, R086, R088

Instead of R086

Connected new 680R resistor to leg of R025 instead of removed R086.

R025 --- R086 new ----*---- 75R resistor --- GROUND
| Red signal from BNC

Same for green and blue.

Sync BNC connector is routed to composite video1 in.

Back mounted rocker switch connects "jungle" IC301 blanking pin 29 to +5V via 1K resistor.









